

An analysis of the guided wave patterns in a pipe by a magnetostrictive sensor technique

Yong-Moo Cheong*, Shin Kim, and Hyun-Kyu Jung
Nuclear Material Research Center, Korea Atomic Energy Research Institute
Yusong P. O. Box 105, Daejeon, 305-600, Korea
Telephone: +82-42-868-8091
Telefax: +82-42-868-8346
E-mail: ymcheong@kaeri.re.kr

Abstract

The magnetostrictive sensor technique has several advantages for practical applications of long-range guided wave inspection, such as a 100-percent volumetric coverage of a long segment of a structure, a reduced inspection time and its cost effectiveness, as well as its relatively simple sensor structure. One promising feature of the magnetostrictive sensor technique is that the wave patterns are relatively clear and simple compared to the conventional piezoelectric ultrasonic transducer. If we characterize the evolution of the defect signals, it could be a promising tool for a structural health monitoring of pipes for a long period as well as the identification of flaws.

In this paper, we attempt to analyze the ultrasonic wave patterns from various artificial defects and geometrical obstacles, such as a support structure in a pipe. Based on the experimental results, theoretical interaction and superposition of those wave patterns are discussed.

1. Introduction

The presence of damage or defects in pipes or tubes is one of the major problems in nuclear power plants. However, in many cases, it is difficult to inspect all of them by the conventional ultrasonic methods, because of their geometrical complexity and inaccessibility. The magnetostrictive guided wave technique has several advantages for practical applications, such as a 100-percent volumetric coverage of a long segment of a structure, a reduced inspection time and its cost effectiveness, as well as its' relatively simple structure.

One promising feature of the magnetostrictive sensor technique is that the wave patterns are relatively clear and simple compared to the conventional piezoelectric ultrasonic transducer. If we can characterize the evolution of the defect signals, it can be a promising tool for a structural health monitoring of pipes for a long period as well as the identification of flaws [1]. An in-bore guided wave probe was developed for an application to small bore heat exchanger tubes [2]. The magnetostrictive probe installed on the hollow cylindrical waveguide generates and detects torsional waves in the waveguide. This waveguide is expanded by the drawbar to create an intimate

mechanical contact between the waveguide and the inside surface of the tube being tested.

In this paper, we analyzed the wave patterns reflected from various artificial holes in a titanium tube, which is used in the condenser in a nuclear power plant. The torsional guided waves were generated and received by a coil and a DC magnetized nickel strip as well as an in-bore guided wave probe. The wave patterns from various defects were compared with two different sensor techniques and a detectable limit of the defected was estimated.

2. Experimental methods

The titanium tubes, similar to the tubes in the condenser in a nuclear power plant were used for the specimen. The dimension of the tubes is an outer diameter of 22.25 mm, thickness of 0.7 mm, and length of 6 m. Several holes with a diameter of 1 mm were fabricated at a distance of 3.5 m from the tube end. A hole is equivalent to 1.5% CSA (cross sectional area) of the tube). A Ni strip width of 25.4 mm was wrapped and bonded along the circumference of the tube with an epoxy.

A DC bias magnetization along the circumference of a tube is required for a generation of a torsional vibration mode, $T(0,1)$. Generally, a circumferential magnetization of a magnetostrictive strip can be achieved by moving a permanent magnet along a circumference. Practically, however, it is not easy for a tube with a small diameter. Alternatively a high DC current along the axial direction can generate a circumferential magnetization. An automotive battery charger that can supply more than 50 Amperes was used for a DC electric current source. In order to obtain a clear signal in the time domain, one cycle of the 128 kHz sinusoidal excitation was applied.

The torsional guided wave were excited and received from one end of each specimen by using the magnetostrictive sensor (MsS) and its instrument system [1]. The signals from the holes were acquired and reprocessed for analysis. The phase and amplitude including waveforms were compared to the size of the reflectors. The detectable limit was considered as three times of the noise level.

In addition to a Ni strip sensor wrapped around the tube, an in-bore guided wave probe was used for a comparison purpose. The phase and amplitude also compared to those from the Ni strip sensor.

3. Results and discussion

Fig. 1 shows the ultrasonic waveforms obtained from the various holes in the titanium tube by a Ni strip sensor. Because of the strip sensor location from the tube end, multiple beam paths are possible, as shown in Fig. 1. There is almost no change or distortion in the waveform structure, except for a variation of the amplitude. The signal amplitude increases, as the number of holes increases from 0 ~ 5, i. e. as the defect size increases and a linear relationship is proposed, as shown in Fig. 2. Based on the signal amplitude by three times the noise level, the detectability of this experimental condition was determined as approximately 0.5% CSA.

Fig. 3 shows that ultrasonic waveforms correspond to Fig. 1, but from an in-bore guided wave probe. The waveform structure is more complicated. We believe the complicated waveform is due to the multiple array structure of the probe.

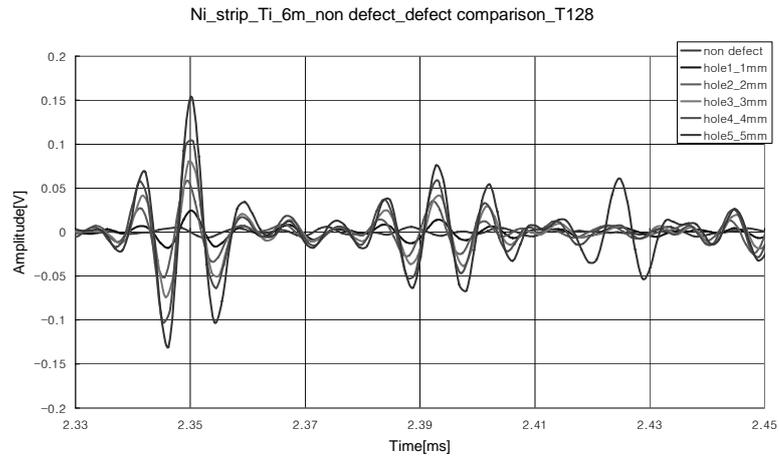


Fig. 1 Comparison of waveforms of various defect sizes with Ni strip sensor. The number of holes is from 0 to 5 at the distance of 3.5 m from the tube end.

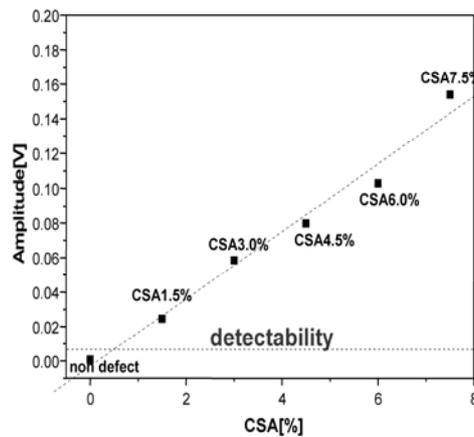


Fig. 2 A plot of amplitudes of various defect sizes with a Ni strip sensor. A detectability was determined based on the three times of the noise level.

It is also noted that there is no change or distortion of the waveform structure, except for a variation of the amplitude. The signal amplitude increases, as the number of holes increases from zero to five, i. e. as the defect size increases and a linear relationship was proposed, as shown in Fig. 2. The detectability is estimated based on the signal amplitude by three times the noise level and determined as below 0.5% CSA. Because the Fe-Co-V alloy strip is used in the in-bore guided wave probe, a higher amplitude is estimated compared to the Ni strip sensor, which results in a good signal-to-noise ratio.

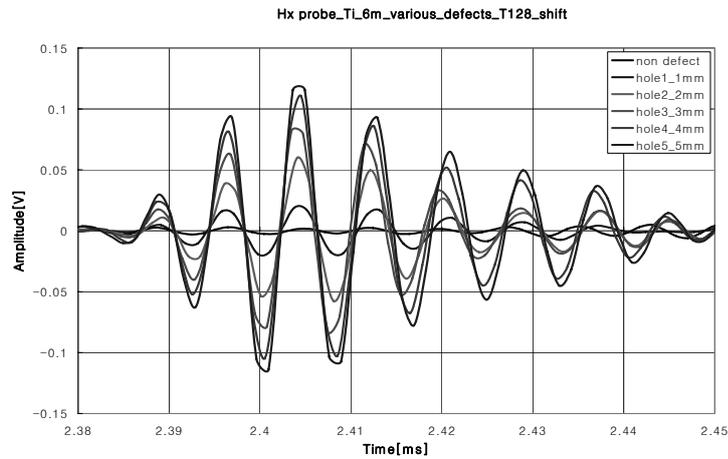


Fig. 3 Comparison of the waveforms of various defect sizes with an in-bore guided wave probe. The number of holes is from zero to five at the distance of 3.5 m from the tube end.

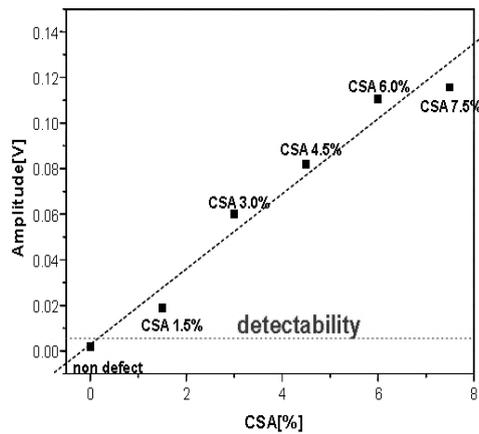


Fig. 4 A Plot of the wave amplitudes of various defect sizes with an in-bore guided wave probe. A detectability was determined based on the three times the noise level.

Figs. 5 and 6 show a typical wave pattern by a Ni strip sensor and an in-bore guided wave probe respectively. As mentioned earlier, the signal pattern in Fig. 5 from the Ni strip sensor is very clear and simple. These signal characteristics can be a potential indicator for a structural health monitoring (SHM) in a pipe experiencing degradation and the evolution of a defect or aging after a performance demonstration, such as a high temperature endurance test.

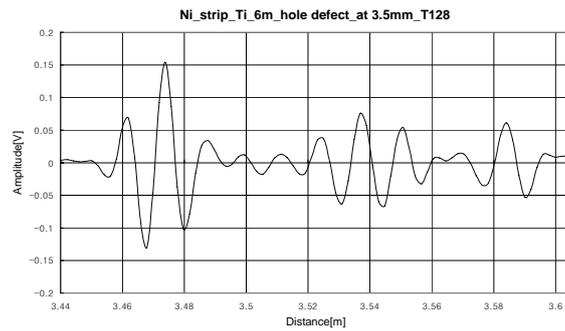


Fig. 5 Typical waveforms by a Ni strip sensor.

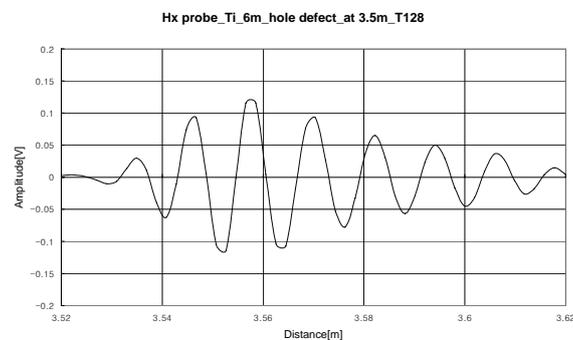


Fig. 6 Typical waveforms by an in-bore guided wave probe.

3. Summary

A magnetostrictive Ni strip sensor was used for a generation of the torsional vibration mode in a Ti heat exchanger tube. After a careful analysis of various defect signals, it was found there is almost no change in waveforms from various sizes of holes except signal amplitude. An in-bore torsional guided wave probe that can access the inside of a tube, was also showed no change in signal shape, except a little longer trailing compared to a result from a Ni strip sensor. We believed the complicated waveform was due to the multiple array structure of the probe

Based on a rule of detectable limit of three times of noise level, the detectability of both sensor techniques was determined as approximately 0.3% of cross-sectional area (CSA), which is excellent to the previous results of 2~3% of CSA.

This approach can be applied to a screening tool in the inspection of heat exchanger tubes as well as a structural health monitoring after a performance demonstration, such as a high temperature endurance test.

Acknowledgements

This work was supported by the research project on the Development of Electromagnetic Ultrasonic Testing Technology for Piping in Nuclear Power Plant, as a

part of the Long-Term Nuclear R&D Program supported by the Ministry of Commerce, Industry and Energy, Korea.

References and footnotes

1. H. Kwun, S. Y. Kim and G. M. Light, “The magnetostrictive sensor technology for long range guided wave testing and monitoring of structure”, *Mater. Eval.* Vol. 61, pp 80-84, 2003.
2. H. Kwun, et al., “A torsional mode guided wave probe for long range, in bore testing of heat exchanger tubing”, *Mater. Eval.* Vol. 62, pp 430-433, 2004.
3. Yong-Moo Cheong and Shin Kim, “Effect of an Alternating Excitation and the Application of an In-Bore Magnetostrictive Transducer for a Long-range Guided Wave Inspection” *Trans. Korean Nuclear Society Fall Meeting*, 2006.